### **SCALPIK DECAP'SEC NW**

HIGH PERFORMANCE LIQUID STRIPPER WITHOUT DCM FOR PAINTS, STAINS, VARNISHES.

FORMS A DRY RESIDUE, NO RINSING REQUIRED.








AST ACTING

ALL SURFACES

- No rinsing necessary
- Dry residues
- Effective and fast
- Does not blacken wood

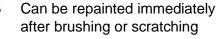

Can be sprayed





### **PACKAGING:**

- 20 L: 24 x 20 L pallet
- 5 L: 4 x 5 L pack
- 750 ml: 24 x 750 ml pack

# A REAS OF APPLICATION

Strips stains, paints, varnishes, thin films from surfaces such as: wood, stone, concrete, iron, zinc, galvanized materials, etc.

# APPLICATION

- 1. DILUTION: Ready to use.
- 2. APPLICATION EQUIPMENT: Special sprayer roller or brush. Could be sprayed with an airless spray gun.
- 3. METHOD: Agitate well before use, then apply to the surface. Clean and scrape any dry residues. This product does not require any rinsing. The surface can be recoated immediately after scraping (ensure surface is fully dry).
- 4. APPLICATION TIME: From 1 to 20 minutes according to the type of coating.
- 5. APPLICATION TEMPERATURE: From 5 to 50°C. Efficacy is reduced at extreme temperatures.
- 6. CLEANING OF TOOLS: Wipe tools with a cloth after use.



cleaning, protection and treatment solutions, with over 65 years as a construction-industry specialist.

7. APPLICATION RATE / From 150 to 300 ml/m2 according to coating.\* 8. STORAGE: Store the product in a frost-free location where it is protected from the weather and away from direct sunlight.

\* Coverage areas are provided for information only and can be used to assess a project. They are in no way contractual; only tests can define the actual amount of product required depending on the surface to be treated.

#### PHYSICOCHEMICAL PROPERTIES

- Solvent-based product
- pH: 2.2
- Colourless to slightly yellowish gel
- Frost resistant
- Density: 1.03 +/- 0.03 g/cm3 at 20°C Viscosity < 100 cps

## A PPLICATION PRECAUTIONS

- 1. PROTECTION OF SURFACES: Do not apply to PVC, rubber, plastic tiles or
- 2. PROTECTION OF PERSONNEL: Avoid contact with eyes and skin. In case of contact, immediately wash with water. Wear PVC gloves and protective eyewear. Do not inhale fumes.

Important: The contents of this documentation result from our experience of the product. We cannot be held responsible for its use in each individual case. It is essential to test areas to be treated beforehand. See the Safety Data Sheet (SDS).



